


## NT H.R.C Low Voltage Fush and Base

### SPECIFICATIONS




NT

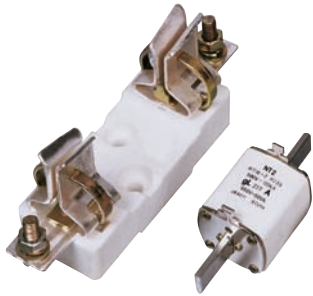

NT2



NT3

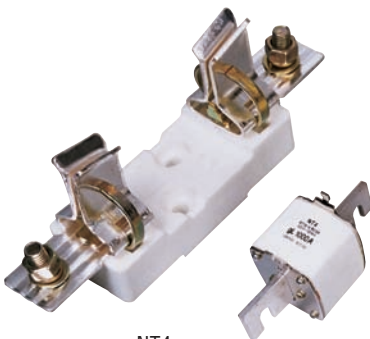

NT4

Type	Fuse link				Fuse base		
	Rated current (A)	Rated voltage (V)	Rated power loss (W)	Weight (kg)	Type	Rated current (A)	Weight (kg)
NT2	125	500, 600	9	0.65	sist 401	400	1.2
	160		11.5				
	200		15				
	224		16.6				
	250		18.4				
	300		21				
	315		19.2				
NT2	355	24.5					
	400	26					

Type	Fuse link				Fuse base		
	Rated current (A)	Rated voltage (V)	Rated power loss (W)	Weight (kg)	Type	Rated current (A)	Weight (kg)
NT3	315	500, 600	21.7	0.85	sist 601	630	1.5
	355		22.7				
	400		26.8				
	425		28.9				
	500		32				

Type	Fuse link				Fuse base		
	Rated current (A)	Rated voltage (V)	Rated power loss (W)	Weight (kg)	Type	Rated current (A)	Weight (kg)
NT4	800	380	62	1.95	sist 1001	1000	3.45
	1000		75				

## Fuse Handle



NTB

